

Euro Z 800 V MI 3144 Instruction manual

Version 1.2.2, Code No. 20 752 881



Distributor:

Manufacturer:

METREL d.d. Ljubljanska cesta 77 1354 Horjul Slovenia

web site: http://www.metrel.si
e-mail: metrel@metrel.si



Mark on your equipment certifies that it meets requirements of all subjected EU regulations.

© 2019 METREL

The trade names Metrel[®], Smartec[®], Eurotest[®], Auto Sequence[®] are trademarks registered in Europe and other countries.

No part of this publication may be reproduced or utilized in any form or by any means without permission in writing from METREL.

Table of contents

1		scriptiones	
		operational considerations	
	2.2 Battery 2.2.1 Ba 2.2.2 Ch	attery indication attery indication arger state echarge	8 8 8
		ion battery pack guidelines ards applied	
	3.1 Instrum	description nent casingor's panel	12
	4.1 Standa	sard setal accessories	13
	•	operation	
		al meaning of keys	
		dicators	
		easurement indication	
		emperature indicationattery indication	
	-	ges on the master instrument	
		erminal voltage monitor	
	5.4 Operat	ion with the master instrument	16
	5.5 Operat	ion with the aMESM	17
6	Tests and N	Measurements	18
		ance Measurements [Z]	
		line mΩ Measurement	
		loop mΩ Measurement	
		gh Current Measurementurce & Line Resistance Measurements [R]	
		line mΩ Measurement	
		Potential [U]	
		touch Measurement	24
		est [I and t]	
		R Current Injection Test	
		R Combination Time Test	
	6.5 Curren 6.5.1 Cu	t [I]urrent Clamp Measurement	28
7		ation	
8	3 Maintenand	se	30
		ng	
		ic calibration	
	8.3 Service	9	30

8.4 Upgrading the instrument	30
9 Technical specifications	31
9.1 Impedance [Z]	
9.1.1 Z line $m\Omega$, Z loop $m\Omega$	
9.1.2 High Current	32
9.1.3 Averaging options	
9.2 DC Source & Line Resistance [R]	33
9.2.1 R line mΩ	33
9.3 Earth Potential [U]	34
9.3.1 U touch	
9.4 Sub-results in measurement functions	34
9.5 ELR Test [I and t]	35
9.5.1 ELR Current Injection Test and ELR Combination Time Test	35
9.6 Current [I]	36
9.6.1 Iron (A 1281) and Flex (A 1227, A 1609) current clamp	36
9.7 Test Current	37
9.8 General data	38
Appendix A – Supported Instruments Selection Table	39
Appendix B – MRCD Test (acc.to IEC 60947-2 Annex M)	40
Appendix C – Short-circuit currents in 3p a.c. systems	44

1 General Description

1.1 Features

Euro Z 800 V (MI 3144) is a Multi-function, portable battery (Li-ion) **or** mains powered test instrument with excellent IP protection: **IP65** (case closed), **IP54** (case opened), intended for: high current line and loop impedance, DC source and line resistance testing, ELR testing and current measurement. It is designed and produced with the extensive knowledge and experience acquired through many years of working in this field.

Available functions and features offered by the Euro Z 800 V:

- Impedance measurement up to 800 V;
- CAT IV 600 V measuring category (altitude up to 3000 m);
- Frequency range from 16 Hz up to 420 Hz;
- Selectable test load (16.6 % to 100 %);
- DC source and line resistance measurement up to 260 V;
- Selective loop measurement;
- Current Clamp Measurement (Iron or Flex Clamps);
- ELR Current injection test;
- > ELR Combination time test;
- Improved thermal performance;
- Bluetooth communication;
- Black box design (Can be remotely controlled from an Android device)

Two LED bar graph indicators offer easy-to-read battery and thermal condition of the instrument. The operation is straightforward and clear to enable the user to operate the instrument without the need for special training (except reading and understanding this Instruction Manual).

MI 3144 Euro Z 800 V	according to
Z line m $Ω$ Z loop m $Ω$	EN 61557 – 3 [loop impedance]
High Current	IEEE Std 81 – 2012 [Integrity of ground systems]
U touch	IEEE Std 81 – 2012 [Testing earth potentials and step and touch voltages]
ELR Current Injection Test ELR Combination Time Test	IEC 60947-2 Annex M [Modular residual current devices]

2 Safety and operational considerations

2.1 Warnings and notes

In order to maintain the highest level of operator safety while carrying out various tests and measurements Metrel recommends keeping your **Euro Z 800 V** instruments in good condition and undamaged. When using the instrument, consider the following general warnings:

- The symbol on the test equipment means »Read the Instruction manual with special care for safe operation«. The symbol requires an action!
- If the test equipment is used in a manner not specified in this Instruction manual, the protection provided by the equipment could be impaired!
- Read this Instruction manual carefully, otherwise the use of the test equipment may be dangerous for the operator, the test equipment itself or for the tested object!
- Do not use the test equipment or any of the accessories if any damage is noticed!
- Regularly check the instrument and accessories for correct functioning to avoid hazard that could occur from misleading results.
- Consider all generally known precautions in order to avoid risk of electric shock while dealing with hazardous voltages! Note that Euro Z 800 V high current impedance adapter is intended for use in environments where dangerous voltages are easy accessible (e.g. switchgears, power stations)!
- Use only standard or optional test accessories supplied by your distributor!
- Do not connect the test equipment to a mains voltage different from the one defined on the label adjacent to the mains connector, otherwise it may be damaged.
- Service intervention, calibration or adjustment is only allowed to be carried out by competent authorized personnel!
- All normal safety precautions must be taken in order to avoid risk of electric shock while working on electrical installations!
- Consider that protection category of some accessories is lower than of the instrument. Test tips have removable caps. If they are removed, the protection falls to CAT II. Check markings on accessories!
 - cap off, 18 mm tip: CAT II up to 1000 V
 - cap on, 4 mm tip: CAT II 1000 V / CAT III 600 V / CAT IV 300 V
- Do not use the equipment in a wet environment, around explosive gas, vapour.
- Only adequately trained and competent persons may operate the equipment.

Markings on the instrument:



Read the Instruction manual with special care to safety operation«. The symbol requires an action!



Front panel can overheat when performing the rapid sequence of high precision line-to-line impedance measurements.



Mark on your equipment certifies that it meets requirements of all subjected EU regulations.



This equipment should be recycled as electronic waste.



This equipment is protected by reinforced insulation.



Warnings related to measurement functions:

- □ Use only standard or optional test accessories supplied by your distributor!
- Always connect accessories to the test equipment and to the test object before starting measurement. Do not touch test leads or crocodile clips during measurement.
- □ Do not touch any conductive parts of equipment under test during the test, risk of electric shock!
- □ Do not connect test terminals (C1, P1, P2, C2 and S) to an external voltage higher than 800 V AC (CAT IV environment) and 260 DC to prevent any damage to the test equipment!
- □ Do not connect live voltage to A 1597 Human body probe.

$Z loop m\Omega$

- □ The Z loop mΩ impedance function will trip-out the RCD in RCD protected installation that is tested. To prevent the RCD trip-out, make measurements on entry side of the RCD or bypass the RCD but only for test purpose.
- Specified accuracy of tested parameters is valid only if mains voltage is stable during the measurement.

Z line $m\Omega$

 Specified accuracy of tested parameters is valid only if mains voltage is stable during the measurement.



Warnings related to Batteries:

- □ Use only batteries provided by the manufacturer.
- □ Never dispose of the batteries in a fire as it may cause them to explode or generate a toxic gas.
- Do not attempt to disassemble, crush or puncture the batteries in any way.
- Do not short circuit or reverse polarity the external contacts on a battery.
- □ Keep the battery away from children.
- □ Avoid exposing the battery to excessive shock/impacts or vibration.
- Do not use a damaged battery.
- □ The Li ion battery contains safety and protection circuit, which if damaged, may cause the battery to generate heat, rupture or ignite.
- Do not leave a battery on prolonged charge when not in use.
- □ If a battery has leaking fluids, do not touch any fluids.
- □ In case of eye contact with fluid, do not rub eyes. Immediately flush eyes thoroughly with water for at least 15 minutes, lifting upper and lower lids, until no evidence of the fluid remains. Seek medical attention.

2.2 Battery and charging of Li-ion battery pack

The instrument is designed to be powered by rechargeable Li-ion battery pack or with mains supply.

2.2.1 Battery indication

The battery indication indicates the charge condition of battery. Press LED bar graph key for test



Battery capacity indication (LED bar graph indicator).

2.2.2 Charger state

The battery is charged whenever the power supply is connected to the instrument. The power supply socket is shown in Figure 2.1. Internal circuit controls (CC, CV) charging and assures maximum battery lifetime. Nominal operating time is declared for battery with nominal capacity of 4.4 Ah.



Figure 2.1: Power supply socket (C7)

The instrument automatically recognizes the connected power supply and begins charging.

Yellow LED	Green LED
On	Undefined
Off	On
Off	Off
Blinking	Undefined
	Typical
	VB 18650
	CC / CV
	7,2 V
	4,4 Ah
	8,0 V
	2,2 A
	2,5 A
	3 hours
	On Off Off

Current Regulation V_{REG} C_{harge} Voltage -I_{CH} C_{harge} Current V_{LOWV} I_{CH/8} Precharge

Typical charging profile which is also used in this instrument is shown in Figure 2.2.

Figure 2.2: Typical charging profile

Fastcharge Safety Time

١٨/	'n	Δ	re	•
٧V		C	ľ	٠

V _{RFG}	Battery charging voltage
	Precharge threshold voltage
	Battery charging current
CH/8	1/8 of the charging current

Time

2.2.3 Precharge

On power up, if the battery voltage is below the V_{LOWV} threshold, the charger applies 1/8 of the charging current to the battery. The precharge feature is intended to revive deeply discharged battery. If the V_{LOWV} threshold is not reached within 30 minutes of initiating precharge, the charger turns off and a FAULT is indicated.

Note:

As a safety backup, the charger also provides an internal 5-hour charge timer for fast

Typical charging time is 3 hours in the temperature range of 5°C to 60°C.

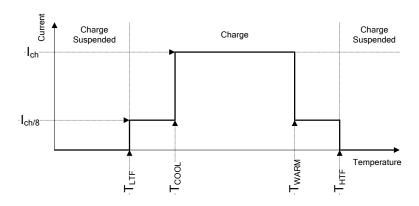


Figure 2.3: Typical charging current vs temperature profile

where:

T _{LTF}	Cold temperature threshold (typ15°C)
	Cool temperature threshold (typ. 0°C)
T _{WARM}	Warm temperature threshold (typ. +60°C)
T _{HTF}	Hot temperature threshold (typ. +75°C)

The charger continuously monitors battery temperature. To initiate a charge cycle, the battery temperature must be within the T_{LTF} to T_{HTF} thresholds. If battery temperature is outside of this range, the controller suspends charge and waits until the battery temperature is within the T_{LTF} to T_{HTF} range.

If the battery temperature is between the T_{LTF} and T_{COOL} thresholds or between the T_{WARM} and T_{HTW} thresholds, charge is automatically reduced to $I_{CH/8}$ (1/8 of the charging current).

2.2.4 Li – ion battery pack guidelines

Li – ion rechargeable battery pack requires routine maintenance and care in their use and handling. Read and follow the guidelines in this Instruction manual to safely use Li – ion battery pack and achieve the maximum battery life cycles.

Do not leave batteries unused for extended periods of time - more than 6 months (self - discharge).

When a battery has been unused for 6 months, check the charge status; see chapter 5.2.2 Battery indication. Rechargeable Li – ion battery pack has a limited life and will gradually lose their capacity to hold a charge. As the battery loses capacity, the length of time it will power the product decreases.

Storage:

- □ Charge or discharge the instruments battery pack to approximately 50% of capacity before storage.
- □ Charge the instrument battery pack to approximately 50% of capacity at least once every 6 months.

Transportation:

□ Always check all applicable local, national, and international regulations before transporting a Li – ion battery pack.



Handling Warnings:

- □ Do not disassemble, crush, or puncture a battery in any way.
- □ Do not short circuit or reverse polarity the external contacts on a battery.
- Do not dispose of a battery in fire or water.
- □ Keep the battery away from children.
- Avoid exposing the battery to excessive shock/impacts or vibration.
- Do not use a damaged battery.
- □ The Li ion battery contains safety and protection circuit, which if damaged, may cause the battery to generate heat, rupture or ignite.
- Do not leave a battery on prolonged charge when not in use.
- □ If a battery has leaking fluids, do not touch any fluids.
- □ In case of eye contact with fluid, do not rub eyes. Immediately flush eyes thoroughly with water for at least 15 minutes, lifting upper and lower lids, until no evidence of the fluid remains. Seek medical attention.

2.3 Standards applied

The Euro Z 800 V instrument is manufactured and tested in accordance with the following regulations:

Electrical equipment for measurement, control and laboratory use – EMC requirements Class A Safety (LVD) EN 61010 - 1 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 1: General requirements EN 61010 - 2 - 030 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
Electrical equipment for measurement, control and laboratory use – EMC requirements Class A Safety (LVD) EN 61010 - 1 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 1: General requirements EN 61010 - 2 - 030 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	Electromagnetic compatibility (EMC)							
Safety (LVD) EN 61010 - 1 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 1: General requirements EN 61010 - 2 - 030 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
Safety (LVD) EN 61010 - 1 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 1: General requirements EN 61010 - 2 - 030 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
EN 61010 - 1 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 1: General requirements Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
and laboratory use – Part 1: General requirements EN 61010 - 2 - 030 Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		Safety requirements for electrical equipment for measurement, control						
Safety requirements for electrical equipment for measurement, control and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
and laboratory use – Part 2-030: Particular requirements for testing and measuring circuits EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	FN 61010 - 2 - 030							
EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	211 01010 2 000							
EN 61010 - 031 Safety requirements for hand-held probe assemblies for electrical measurement and test. EN 61010 - 2 - 032 Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 - 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		·						
measurement and test. Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	FN 61010 - 031							
Safety requirements for electrical equipment for measurement, control, and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	EN OTOTO OUT	· · ·						
and laboratory use – Part 2-032: Particular requirements for hand-held and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	EN 61010 - 2 - 032							
and hand-manipulated current sensors for electrical test and measurement Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		· · · · · · · · · · · · · · · · · · ·						
Some further recommendations EN 61557 Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		•						
Electrical safety in low voltage distribution systems up to 1000 V a.c. and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and	Some further recomn							
and 1500 V d.c Equipment for testing, measuring or monitoring of protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
protective measures. Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and								
Part 1: General requirements Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		1 1						
Part 3: Loop resistance IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		·						
IEEE 81 – 2012 IEEE Guide for Measuring Earth Resistivity, Ground Impedance, and		· ·						
3 3 7	IEEE 81 - 2012	·						
Farth Surface Potentials of a Grounding System		Earth Surface Potentials of a Grounding System.						
EN 60947-2 Low-voltage switchgear and controlgear – Part 2: Circuit-breakers –	EN 60947-2							
Annex M Modular residual current devices (without integral current								
breaking device)		,						
EN 60909 - 0 Short-circuit currents in three-phase a.c.systems – Part 0: Calculation	FN 60909 - 0							
of currents	LI 00000 0	·						
	Li – ion battery pack							
EN 62133 - 2 Secondary cells and batteries containing alkaline or other non-acid		Secondary cells and batteries containing alkaline or other non-acid						
electrolytes - Safety requirements for portable sealed secondary cells								
and for batteries made from them, for use in portable applications –								
Part 2: Lithium systems								

Note about EN and IEC standards:

□ Text of this manual contains references to European standards. All standards of EN 6XXXX (e.g. EN 61010) series are equivalent to IEC standards with the same number (e.g. IEC 61010) and differ only in amended parts required by European harmonization procedure.

3 Instrument description

3.1 Instrument casing

The instrument is housed in a plastic box that maintains the protection class defined in the general specifications.

3.2 Operator's panel

The operator's panel is shown in Figure 3.1 below.

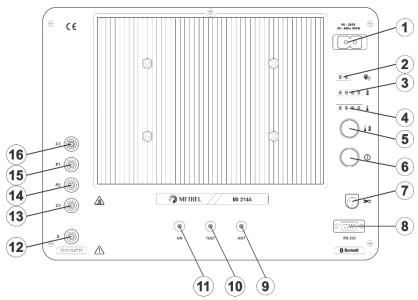


Figure 3.1: The operator's panel

1		Input power supply (charger) socket (type C7).
2		Charger status (green and yellow LED indicators).
3		Battery status (LED bar graph).
4		Temperature status (LED bar graph).
5	LED bar graph key (active if pressed).	
6 On/Off Switch the instrument power on or off.		
		Instrument hard reset (if hold for 10 s or more).
7	Clamp	Clamp input terminal (Only for connection of Metrel Smart
		clamps).
8	RS232	RS232 communication port.
9	HOT	Instrument overheated.
10	TEST	Measurement status.
11	ON	Power indication.
12 - 16	S, C1, P1, P2, C2	Measuring terminals.

Warnings!

- Do not connect test terminals (C1, P1, P2, C2) to an external voltage higher than 800 V AC (CAT IV environment) or 260 V DC to prevent any damage to the test equipment!
- Use original test accessories only!

4 Accessories

The accessories consist of standard and optional accessories. Optional accessories can be delivered upon request. See *attached* list for standard configuration and options or contact your distributor or see the METREL home page: http://www.metrel.si.

4.1 Standard set

- □ Instrument MI 3144 Euro Z 800 V
- □ Large Kelvin test clips (A 1593), 2 pcs
- □ Test lead 5 m, 2 pcs (black/red)
- □ Test tip, 2 pcs (red)
- □ Test tip, 2 pcs (black)
- □ Test lead 5 m, 2 pcs (green)
- □ G clamp, 1 pc
- □ Crocodile clips, 2 pcs (black)
- □ RS232 cable (9 pin PS2)
- Mains cable
- Bag for accessories
- Instruction manual
- Calibration certificate

4.2 Optional accessories

See the attached sheet for a list of optional accessories and licence keys that are available on request from your distributor.

5 Instrument operation

According to principle, the instrument offers remote control from METREL instruments whose test functions are implemented by application of the Euro Z.

5.1 General meaning of keys



LED bar graph key is used to:

Power up the temperature and battery bar graph indication;

ON / OFF key:



- Switches the instrument power on or off;
- □ Instrument hard reset (hold key for 10 s or more).

The instrument automatically turns off 10 minutes after the last key was pressed and no communication with the master instrument or app.

5.2 LED indicators

5.2.1 Measurement indication

LED	Status	Description	
	ON	Power indication.	
ON	Blinking	Low battery.	
TEST	ON	Measurement status. LED is activated while measurement is running.	
HOT Blinking instrument rea		Overheated. Temperature of internal components in the Euro Z instrument reached top limit. The measurement is prohibited until temperature drops below the limit.	
ON TEST HOT	Blinking	Hardware error. (Input relay failure detected.) Measurements are prohibited! Service intervention is required!	

5.2.1 Temperature indication

The temperature indicates the condition of the loading resistor.



Temperature indication (LED bar graph indicator). Cool, Mild, Warm, Hot

5.2.2 Battery indication

The battery indication indicates the charge condition of battery.



Battery capacity indication (LED bar graph indicator). Low, Middle, Good, Full

5.3 Messages on the master instrument

Warning!

Low battery on the Euro Z adapter.

Select **OK** for acknowledgement; connect power supply to the Euro Z instrument and recharge the batteries.

Warning!

Euro Z adapter is overheated. The measurement is prohibited until the temperature decreases under the allowed limit.

Select **OK** for acknowledgement; cool down the Euro Z instrument.

Warning!

Wrong voltage system or nominal mains voltage out of range!

Select **OK** for acknowledgement; limit [40 V ≤ Uac ≤ 800 V].

Warning!

Wrong frequency system!

Select **OK** for acknowledgement; limit [16 Hz \leq f \leq 420 Hz].

Warning!

Wrong voltage system, voltage out of range or wrong polarity +, -!

Select **OK** for acknowledgement; limit [3 V ≤ Udc ≤ 260 V].

Error!

Connection! Check the correct terminals connection (C1, P1, P2, C2)! See help for more information.

Select **OK** for acknowledgement.

Error!

Hardware Error!

The measurement is prohibited.

Select **OK** for acknowledgement; Input relay failure detected. Service intervention is required.

5.3.1 Terminal voltage monitor

The terminal voltage monitor displays on-line voltages and frequency on the test terminals.

Up1p2	RMS voltage across P1 – P2 measuring terminals.
Uc1c2	RMS voltage across C1 – C2 measuring terminals.
Freq	RMS frequency across C1 – C2 measuring terminals.

5.4 Operation with the master instrument

(e.g. MI 3155 EurotestXD, MI 3152 EurotestXC)

Applied functions

See Appendix A – Supported Instruments Selection Table for more information.

Connection with the master instrument (RS232 or Bluetooth)

For RS 232 communication, connect serial communication interface cable RS 232_9pin_female / PS 2 to the master instrument and the Euro Z instrument. See Figure 5.1.





Figure 5.1: Connection of the Euro Z 800 V to the master instrument using RS 232 or Bluetooth (Example of MI 3152 and MI 3155)

- Power on the master instrument and the Euro Z instrument.
- Select the communication port RS 232 or Bluetooth on the master instrument.





Figure 5.2: Master instrument Setting menu

- □ Set (pair) the appropriate Bluetooth device from a list of detected Bluetooth devices. The correct name consists of the instrument type plus serial number, e.g. *MI* 3144-12345678*I*.
- Select measurement function on the master instrument from the EURO Z group.
- □ The master instrument recognizes the Euro Z instrument in the measurement window by activating terminal voltage monitor and with Bluetooth indication (if Bluetooth communication is set).



Figure 5.3: Terminal voltage monitor – activated and not activated



Figure 5.4: Bluetooth indication - connected and disconnected

- Select the proper parameters and limits of the selected measurement on the master instrument.
- □ Connect the Euro Z instrument to the test object. (Check terminal voltage monitor for proper connection. Use help screens on master instrument if necessary.)
- □ Press TEST/ RUN/ ENTER key on the master instrument to measure.
- Result of measurement is displayed on the master instrument.

5.5 Operation with the aMESM

Applied functions

See Appendix A – Supported Instruments Selection Table for more information.

Connection with aMESM (Bluetooth)

- □ Power on the Euro Z instrument and the tablet or smart phone.
- □ Enable the Bluetooth hardware on the tablet or smart phone device.
- Run aMESM application on the tablet or smart phone device.



Figure 5.5: Connection of the Euro Z 800 V to the aMESM

- □ Search for the appropriate device (your Euro Z instrument) in the Bluetooth menu and connect to it. The correct name consists of the instrument type plus serial number, e.g. *MI* 3144-12345678*I*.
- □ Bluetooth communication device pairing code is 1234.
- Select measurement function on the aMESM.
- Select the proper parameters and limits.
- Connect the Euro Z instrument to the test object.
- Press the START key on the aMESM application to measure.
- Result of a measurement is displayed on the aMESM application.

6 Tests and Measurements

The MI 3144 Euro Z 800 V instrument is able to carry out different measurement methods. The operator can select the appropriate one.

6.1 Impedance Measurements [Z]

When performing measurements close to the power transformer or inductance is present, inductive part of impedance has a significant influence to prospective fault/short-circuit current. Therefore, impedance has to be measured (instead of resistance) for correct calculation of prospective fault/short-circuit current.

AC	Measurement	Test	Test	Limit
Impedance		Mode	Method	
	Z line mΩ	single	4-wire	yes
Z	Z loop mΩ	single	4-wire	yes
	High Current	single	4-wire + clamp	yes

High precision line and fault loop impedance measurements are performed using high current impulses to assure adequate voltage drop during the test.

Warnings:

- □ The Euro Z instrument applies very high loading current into tested installation and it is recommended to make rare measurements, typically one per 15 s to reduce problems caused by such current.
- □ Flickers can be observed due to high test current pulses.

6.1.1 Z line mΩ Measurement



Line impedance is the impedance within the current loop when a short-circuit occurs:

- Conductive connection between phase conductor and neutral conductor in single-phase system,
- Between two line conductors in three-phase system.

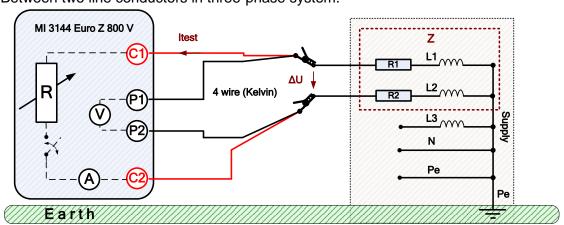


Figure 6.1: Z line $m\Omega$ measurement example

During the measurement, an internal resistance is connected between C1 and C2 for a period of a half cycle. The instrument internal shunt resistor measures the current (I_{test}). A voltmeter measures the open circuit voltage with no load ($U_{UNLOADED}$), followed by the second reading with a load (U_{LOADED}). The impedance Z is determined from the voltage dip / current ratio. In the example, following impedance is measured:

$$Z = \frac{U_{UNLOADED} - U_{LOADED}}{I_{test}} = \frac{\Delta U}{I_{test}}$$

where:

Z......Impedance

U_{UNLOADED}...... Measured voltage [no load] U_{LOADED}...... Measured voltage [with load]

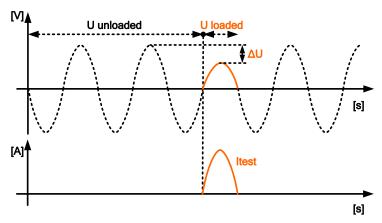


Figure 6.2: Z line $m\Omega$ measurement voltage and current waveforms examples

Z MΩL-Pe **Z loop m**Ω

6.1.2 Z loop mΩ Measurement

Loop impedance is the impedance within the fault loop when a short-circuit to exposed conductive parts occurs (conductive connection between phase conductor and protective earth conductor).

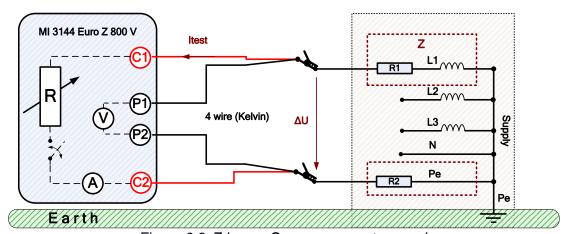


Figure 6.3: Z loop $m\Omega$ measurement example

During the measurement, an internal resistance is connected between C1 and C2 for a period of a half cycle. The instrument internal shunt resistor measures the current (I_{test}). A voltmeter measures the open circuit voltage with no load ($U_{UNLOADED}$), followed by the second reading with a load (U_{LOADED}). The impedance Z is determined from the voltage dip / current ratio. In the example, following impedance is measured:

$$Z = \frac{U_{UNLOADED} - U_{LOADED}}{I_{test}} = \frac{\Delta U}{I_{test}}$$

where:

Z......Impedance

U_{UNLOADED}...... Measured voltage [no load] U_{LOADED}..... Measured voltage [with load]

6.1.3 High Current Measurement



The measurement can be applied for measuring contact resistance (bad contacts) in a live distribution board or fuse box. With test currents from 10 A and all the way to the 100 A, depending on the mains voltage and test load parameter. For more information, see chapter **9.7 Test Current.**

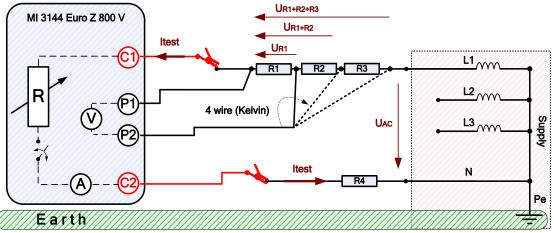


Figure 6.4: High Current Measurement example 1 (distribution board)

Proposed measurement can be referenced to standard IEEE-81 par. 10.2 and 10.3.

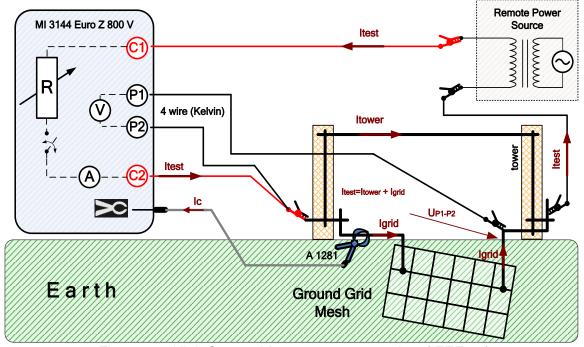


Figure 6.5: High Current Measurement example 2 (IEEE-81)

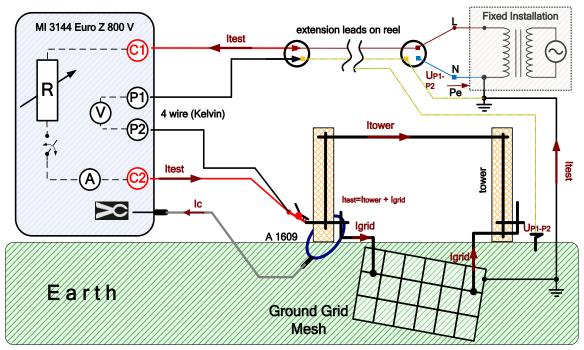


Figure 6.6: High Current Measurement example 3 (IEEE-81)

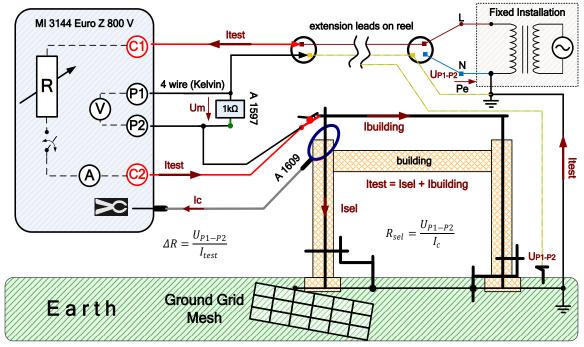


Figure 6.7: High Current Measurement example 4 (IEEE-81)

During the measurement, an internal resistance is connected between C1 and C2 for a period of a half cycle. The current is measured by the Euro Z instrument (I_{test}) and optionally by the clamp current (I_c). The supply network and test load setting determines the current amplitude. A higher current amplitude improves the immunity against voltage noise. Potential probes P1 and P2 measure the voltage dip. The resistance R is determined from the voltage / current ratio and the selective resistance (R_{sel}) is determined from the voltage / clamp current ratio.

In the example, following resistance and selective resistance is measured:

$$\Delta R = \frac{U_{P1-P2}}{I_{test}} \qquad \qquad R_{sel} = \frac{U_{P1-P2}}{I_c}$$

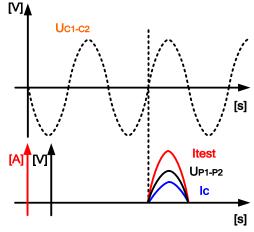


Figure 6.8: High Current measurement voltage and current waveforms examples

6.2 DC Source & Line Resistance Measurements [R]

DC	Measurement	Test	Test	Limit
Resistance		Mode	Method	
R	R line m Ω	single	4-wire	yes

Table 6.9: Available DC Resistance measurements in the MI 3144

6.2.1 R line $m\Omega$ Measurement



R line $m\Omega$ measurement is intended for checking the internal resistance of larger batteries (fully charged) or for checking DC installations up to 260 Vdc.

The battery or dc voltage source receives a short discharge. The discharge current is set according to the value of the applied DC voltage source ($U_{DC_UNLOADED}$) and max power of the internal load.

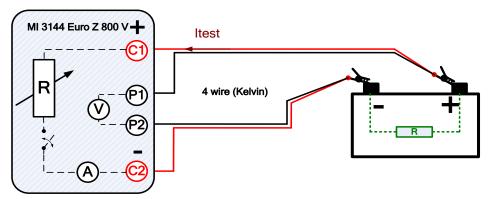


Figure 6.10:R line $m\Omega$ Measurement example 1 (battery)

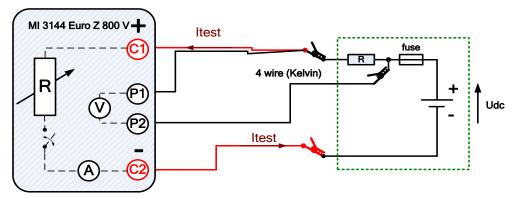


Figure 6.11:R line $m\Omega$ Measurement example 2 (DC installation)

During the measurement, an active internal resistance is connected between C1 (+) and C2 (-) for 20 ms. The instrument internal shunt resistor measures the current (I_{test}). A voltmeter measures the open circuit voltage with no load ($U_{DC_UNLOADED}$), followed by the second reading with a load (U_{DC_LOADED}). The resistance R is determined from the voltage dip / current ratio. In the example, following resistance is measured:

$$R = \frac{U_{DC_UNLOADED} - U_{DC_LOADED}}{I_{test}} = \frac{\Delta U}{I_{test}}$$

Figure 6.12: R line $m\Omega$ measurement - voltage and current waveforms examples

[s]

6.3 Earth Potential [U]

AC	Measurement	Test	Test	Limit
Voltage		Mode	Method	
U	U touch	single	4-wire	yes

Table 6.13: Available Earth Potential measurements with the MI 3144

Note (acc.to IEEE Std 81):

□ Touch voltage - general definition. The potential difference between the GPR of a grounding grid or system and the surface potential where a person could be standing while at the same time having a hand in contact with a grounded structure or object.

6.3.1 U touch Measurement



Proposed measurement can be referenced to standard IEEE-81 par. 9.

The measurement is performed between an earthed accessible metal part and ground as shown on *Figure 6.14*. The voltage between the probes is measured by a voltmeter with an external resistance of 1 k Ω (adapter A 1597) that simulates the body resistance.

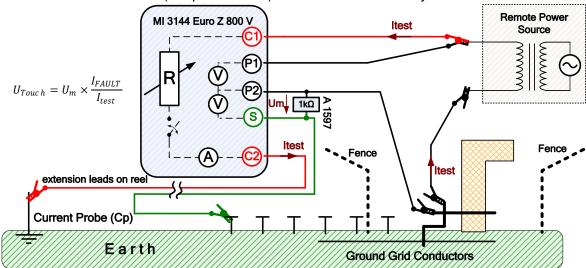


Figure 6.14: U touch Measurement example

During the measurement, an internal resistance is connected between C1 and C2 for a period of a half cycle. The resistance of the current probe should be as low as possible in order to inject a high test current. The resistance can be decreased by using more probes in parallel or using an auxiliary earthing system as the auxiliary probe. A higher injected current improves the immunity against spurious earth currents. The instrument internal shunt resistor measures the current (I_{test}). A voltmeter measures the voltage drop across a 1 k Ω resistor (A 1597). The (U $_{Touch}$) voltage is determined from the fault current / measured current ratio multiplied with the measured voltage. In the example, following U $_{Touch}$ voltage is measured:

$$U_{Touch} = U_m \times \frac{I_{FAULT}}{I_{test}}$$

where:

 $U_{\text{Touch}}\,$ Calculated Touch voltage in case of a fault current

I_{FAULT}...... Set fault current (maximal earth current in case of a fault)

U_m Measured voltage drop

I_{test} Test current

6.4 ELR Test [I and t]

The MI 3144 Euro Z 800 V instrument is supporting testing of ELR-s or Modular Residual Current Devices (MRCD) without integral current breaking devices and with separate sensing means.

MRCD	Measurement	Test	ELR	Limit	Filter
Test		Mode	Type		
1 +	ELR Current Injection Test	single	AC, A, B	yes	AC/DC
1, t	ELR Combination Time Test	single	AC, A, B	yes	AC/DC

Table 6.15: Available ELR measurements in the MI 3144

Note (acc.to IEC 60947-2 Annex M):

□ The ELR (MRCD) shall be installed, mounted and wired according to the manufacturer's instructions. Unless otherwise specified, it is connected to a test equipment, as specified by the manufacturer, representing normal service conditions for the output circuit in order to verify the change in the status of the output. For the measurement of the combination time, the ELR is connected to a circuit-breaker, specified by the manufacturer, and installed on the monitored circuit.

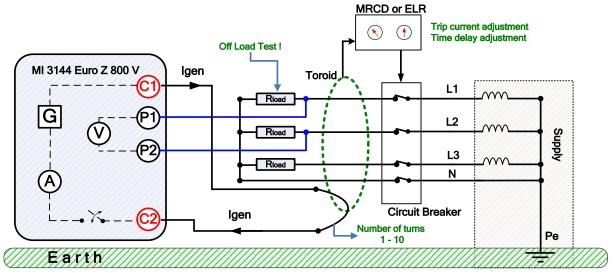


Figure 6.16: ELR Current Injection Test and Combination Time Test example

I_{gen}, Test duration, Number of turns and Current waveform shape relations:

I _{gen}	Test duration (s)	Number of turns	Curr	ent Waveform sha	ipe
			Alternating	Pulsed	DC
3 mA			AC	А	В
5 mA		1	AC	А	В
6 mA	0.0	2	AC	А	В
10 mA	0.3	3	AC	А	В
15 mA	0.5	4	AC	А	В
30 mA	1 2	5	AC	А	В
50 mA	5	6	AC	А	В
100 mA	10	7	AC	А	В
150 mA	20	8	AC	А	•
250 mA	20	9	AC	А	•
300 mA		10	AC	А	•
500 mA			AC	•	•

Table 6.17: Available generation currents in the MI 3144

6.4.1 ELR Current Injection Test ELR Current Injection



Verification of operation in case of a steady increase of the residual current.

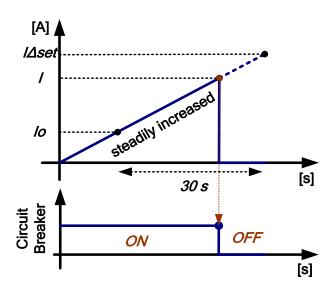


Figure 6.18: ELR Current Injection Test waveforms example

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **steadily increased**, starting form a value not higher than 10 % of $I_{\Delta set}$, up to $I_{\Delta set}$ value in approximately 30 s. The current value causing tripout of the ELR (MRCD) - change to (OFF) state in the status of the circuit breaker is displayed as I.

 $I_{\Delta set}$ is calculated as follows:

$$I_{\Delta set} = I_{gen} \times \text{(number of turns)}$$

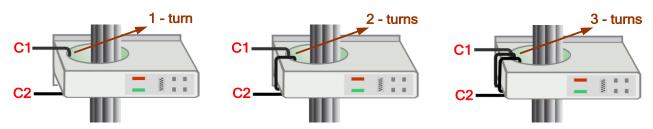


Figure 6.19: Number of turns - example

6.4.2 ELR Combination Time Test



Verification of the correct operation in case of a suddenly appearing residual current.

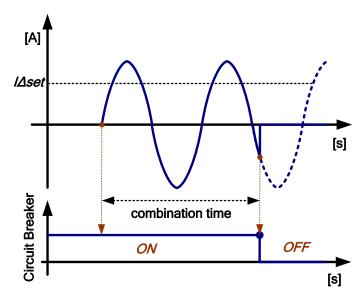


Figure 6.20: ELR Combination Time Test current waveforms example

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **suddenly established** (set value). The instrument is measuring the combination time (ELR + Circuit Breaker) from establishing the current ($I_{\Delta set}$) to the change detected in the circuit breaker OFF state.

where:

t....... Total operating time or combination time.

 $I_{\Delta set}$ Set current value (I_{gen} multiplied by number of turns).

6.5 Current [I]

Current	Measurement	Test Mode	Nominal frequency	Filter	Туре	Max. Measuring range
					A1227	3000 A
1	Current Clamp Meter	cont.	16 Hz – 420 Hz	RMS	A1281	1000 A
					A1609	3000 A

Table 6.21: Available Current measurements in the MI 3144

6.5.1 Current Clamp Measurement



A1281 AC current clamp

The A 1281 multi range current clamps are designed for measuring alternating currents on low

and medium power installations: (50 mA ... 1000 A). Clamps have four current ranges 0.5 A, 5 A, 100 A and 1000 A, which are selected directly on master instrument. Embedded electronic module is powered directly from the connected Euro Z instrument and does not need any additional power supply.


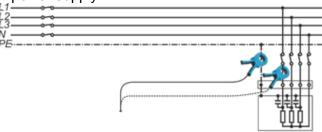


Figure 6.22: A1281 Clamp example

A1227 and A1609 Flex current clamp

1. Wrap the flexible measuring head around the conductor to be tested and close coupling.

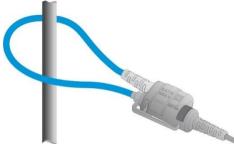

- It is very important that the conductor is in the centre and perpendicular to the current censor as much as possible, in order to minimise position measurement error.
- Minimise influence of adjacent current-carrying conductors, and measure at the point where they are far away from each other.
- Make sure that the arrow marked on the clamp coupling points toward the correct orientation for correct phase.
- Keep the clamps coupling more than 2.5 cm (1 in) away from conductor.
- 2. Connect Flexible Current Clamps to the clamp input on the Euro Z instrument.
- 3. Select appropriate Current clamp range.
- 4. Start measurement.
- 5. Observe the current value on the master instrument's display. If desired, select the lower clamp range for better accuracy.

MI 3144 Euro Z 800 Communication

7 Communication

There are two communication interfaces available on the Euro Z instrument for communication with master instrument or Android device: RS-232 and Bluetooth.

RS-232 communication

Serial interface cable is required. See following figures for correct connection.

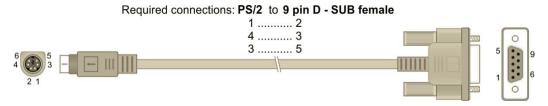


Figure 7.1: RS-232 connection – (Example of connection with MI 3152 or MI 3155)

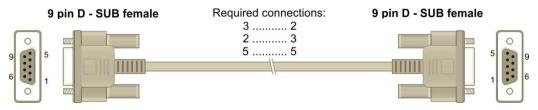


Figure 7.2: RS-232 connection (Example of connection to master instrument with standard 9pin D-SUB type serial port)

Bluetooth communication

The internal Bluetooth module enables easy communication via Bluetooth with PC and Android devices.

How to configure a Bluetooth link between Euro Z instrument and Android device

- Switch On the Euro Z instrument.
- Some Android applications automatically carry out the setup of a Bluetooth connection. It is preferred to use this option if it exists. This option is supported by Metrel's Android applications.
- If this option is not supported by the selected Android application then configure a Bluetooth link via Android device's Bluetooth configuration tool. Usually no code for pairing the devices is needed.
- The instrument and Android device are ready to communicate.

Notes

- □ Sometimes there will be a demand from the PC or Android device to enter the code. Enter code '1234' to configure the Bluetooth link correctly.
- The name of correctly configured Bluetooth device must consist of the instrument type plus serial number, e.g. MI 3144-12345678I. If the Bluetooth module got another name, the configuration must be repeated.

8 Maintenance

Unauthorized persons are not allowed to open the Euro Z instrument. There are no user replaceable components inside the instrument. Batteries can only be replaced with certified ones and only by authorized persons.

8.1 Cleaning

No special maintenance is required for the housing. To clean the surface of the instrument, use a soft cloth slightly moistened with soapy water or alcohol. Then leave the instrument to dry totally before use.

Warnings:

- Do not use liquids based on petrol or hydrocarbons!
- Do not spill cleaning liquid over the instrument!

8.2 Periodic calibration

It is essential that the test instrument is regularly calibrated in order that the technical specification listed in this manual is guaranteed. We recommend an annual calibration. Only an authorized technical person can do the calibration. Please contact your dealer for further information.

8.3 Service

For repairs under warranty, or at any other time, please contact your distributor.

8.4 Upgrading the instrument

The Euro Z instrument can be upgraded from a PC via the RS232 communication port. This enables to keep the Euro Z instrument up to date even if the standards or regulations change. Download the latest firmware on the Metrel download centre:

https://www.metrel.si/en/downloads/

Special upgrading software - **FlashMe** will guide you through the upgrading procedure. For correct connection, see *Figure 8.1*. Contact your dealer for more information.

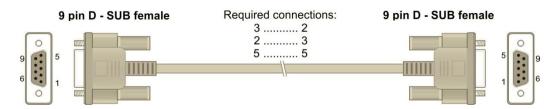


Figure 8.1: RS-232 Interface connection required for upgrading the Euro Z instrument

9 Technical specifications

9.1 Impedance [Z]

9.1.1 Z line m Ω , Z loop m Ω

Measuring range according to EN 61557-3: 12.0 m Ω ... 19.99 Ω

Line Impedance Loop Impedance	Measuring range (Ω)	Resolution (m Ω)	Uncertainty (* See notes)
	0.1 m 199.9 m	0.1	±(F 0/ of reading + 2 mO)
Z	200 m 1999 m	1	\pm (5 % of reading + 3 m Ω)
	2.00 19.99	10	\pm (5 % of reading + 3 digits)

Test mode single

Measuring voltage range 40 V ... 470 V @ (16 Hz ... 420 Hz)

40 V ... 800 V @ (40 Hz ... 420 Hz)

Measuring frequency range...... 16 Hz ... 420 Hz

Maximum test current see chapter 9.7 Test Current, Figure 9.3

Displayed Prospective Short Circuit Current (I_{psc}) is calculated as follows:

$$I_{psc} = \frac{U_n \times k_{sc}}{Z}$$

If the Nominal Voltage (U_n) is in the tolerance of ± 6 % or ± 10 % (parameter setting!) than the prospective short current (I_{psc}) will be calculated. Exceeding the nominal voltage tolerance by ± 6 % or ± 10 % then I_{psc} will not be calculated and the horizontal dashes (- - -) will be displayed.



where:

Z..... measured Impedance

U_n...... nominal voltage

Refer to Appendix C- Short-circuit currents in 3p a.c. systems for more information.

* Notes:

- System voltage and frequency kept constant during measurement!
- When measuring at low current amplitudes (test load parameter set to 16.6 % and 33.3 %) the result can vary!
- If the measurement triggers a fuse (the voltage drops to zero), the measurement will abort (stop).



Measurement is aborted. Consider displayed warnings and messages.

9.1.2 High Current

Resistance	Measuring range (Ω)	Resolution (m Ω)	Uncertainty (* See notes)
	0.1 m 199.9 m	0.1	+/F 0/ of reading + 2 m()
ΔR	200 m 1999 m	1	\pm (5 % of reading + 3 m Ω)
	2.00 19.99	10	\pm (5 % of reading + 3 digits)

Selective Resistance	Measuring range (Ω)	Resolution (m Ω)	Uncertainty (* See notes)
	0.1 m 199.9 m	0.1	+(9 % of reading + 2 mO)
Rsel	200 m 1999 m	1	\pm (8 % of reading + 3 m Ω)
	2.00 19.99	10	\pm (8 % of reading + 3 digits)

Test mode single

40 V ... 800 V @ (40 Hz ... 420 Hz)

Measuring frequency range...... 16 Hz ... 420 Hz

Maximum test current see chapter 9.7 Test Current, Figure 9.3



* Notes:

- System voltage and frequency kept constant during measurement!
- When measuring at low current amplitudes (test load parameter set to 16.6 % and 33.3 %) the result can vary!
- Minor exceeding the clamp range will cause the instrument to display > and the appropriate range (e.g. >599 A).
- Large exceeding of the clamp range or wrong clamps selected will cause the horizontal dashes (- -)
 to be displayed.
- Uncertainty of R_{sel} depends on the correct or optimum selection of the clamp range!
- If the measurement triggers a fuse (the voltage drops to zero), the measurement will abort (stop).



Low test current through Iron or Flex clamps. Results may be impaired. Limit [Ic (test current) < 10 % of range].

9.1.3 Averaging options

Additional averaging is built within the instrument to reduce the influence of noise on measurement results. This option enables more stable results especially when dealing with low impedance measurement in noisy environment with interharmonics and power-line flickers.

Measurement function Z line $m\Omega$, Z loop $m\Omega$, High Current

In the measurement function, the status of the averaging option is shown in the measurement control window. The table below contains a definition of the individual averaging options and measuring times:

A. compains antions	Magning	Typical measuring times (s)		
Averaging options	Meaning	@ 230 V, 50 Hz	@ 415 V, 50 Hz	@ 690 V, 50 Hz
Off (1)	Averaging is disabled	3	3	3
2	Average of 2 results	4	5	7
4	Average of 4 results	7	10	15
6	Average of 6 results	10	15	25

9.2 DC Source & Line Resistance [R]

9.2.1 R line mΩ

Measurement principle: Voltage (dc) / Current (dc) measurement

Resistance	Measuring range (Ω)	Resolution (m Ω)	Uncertainty (* See notes)	
R	0 m 1999 m	1	\pm (5 % of reading + 3 digits)	
	2.00 19.99	10		

Test Current (I_{test}) is automaticaly set as follows and is dependent of the internal resistance (R_{int}) of the measured object:

$$I_{test} pprox rac{200\,W}{U_{dc}}$$
 and $I_{test} < rac{U_{dc}}{R_{
m int}}$ 3 Vdc Nominal voltage range 260 Vdc

* Notes:

- System voltage kept constant during measurement!
- Battery must be fully charged to measure the internal resistance.

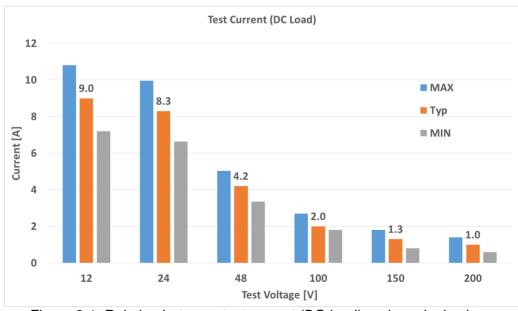


Figure 9.1: Relation between test current (DC load) and nominal voltage

9.3 Earth Potential [U]

9.3.1 U touch

Measurement principle Current / Voltage measurement

Voltage	Measuring range (V)	Resolution (V)	Uncertainty (* See notes)	
Litauah	0.0 199.9	0.1	calculated value	
Utouch	200 999	1	calculated value	

Test mode single

40 V ... 800 V @ (40 Hz ... 420 Hz)

Measuring frequency range...... 16 Hz ... 420 Hz

Maximum test current see chapter 9.7 Test Current, Figure 9.3

Measuring time...... typical 2 s Input resistance (P1 – P2) 6 M Ω

Input resistance (P2 – S) 6 M Ω Ifault range (selectable) Custom, 10 A ... 200 kA

Displayed Touch Voltage (U_{Touch}) is calculated as follows:

$$U_{Touch} = U_m \times (\frac{I_{fault}}{I_{test}})$$

Sub-result in measurement function U_{Touch}:

Voltage	Measuring range (V)	Resolution (V)	Uncertainty (* See notes)
	1 m 1999 m	1 m	
Um	2.00 19.99	10 m	\pm (2 % of reading + 2 digits)
	20.0 199.9	0.1	

*Notes:

- A 1597 Human body probe with an internal resistance of 1 $k\Omega$ ±1 %, 10 W.
- System voltage and frequency kept constant during measurement!
- When selecting high I_fault parameters > 50 kA. Measuring at low current amplitudes (test load parameter set to 16.6 % and 33.3 %) the result can vary!

9.4 Sub-results in measurement functions

Sub-result	Measuring range	Resolution	Uncertainty	
R, XL	0 m Ω 19.9 Ω	1 m Ω 0.1 Ω	Indication only	
Ipsc	0.01 A 199 kA	0.01 A 1 kA	calculated value	
Imax, Imin,	0.01 A 199 kA	0.01 A 1 kA		
Imax2p, Imin2p,			calculated value	
Imax3p, Imin3p				
Itest	0.1 A 499 A	0.1 A 1 A	\pm (2 % of reading + 3 digits)	
U	0 V 999 V	1 V	±(2 % of reading + 3 digits)	
Ic	0.1 A 499 A	0.1 A 1 A	\pm (5 % of reading + 3 digits)	
Udc	0.1 V 220 V	0.1 V 1 V	±(2 % of reading + 3 digits)	
ΔU	1 mV 199.9 V	1 mV 0.1 V	\pm (2 % of reading + 3 digits)	
ΔU%	0.0 % 100.0 %	0.1 %	calculated value	
f	0.1 Hz 499 Hz	0.1 Hz 1 Hz	\pm (0.2 % of reading + 1 digit)	

9.5 ELR Test [I and t]

9.5.1 ELR Current Injection Test and ELR Combination Time Test

Measurement principle: Current and time measurement

Residual operating current	Measuring range (A)	Resolution (mA)	Uncertainty (* See notes)
	0.1 m 199.9 m	0.1	
1	200 m 1999 m	1	\pm (5 % of reading + 3 digits)
	2.00 19.99	10	

Measurement principle: Voltage and time measurement

Combination time	Measuring range (s)	Resolution (ms)	Uncertainty	
	0.1 m 199.9 m	0.1		
t	200 m 1999 m	1	\pm (2 % of reading + 3 digits)	
	2.00 20.00	10		

Test mode single

Current Waveform Alternating, Pulsating, DC

0.15 A, 0.25 A, 0.3 A, 0.5 A

Measuring voltage range (P1 - P2)...... 40 V ... 800 V

Measuring frequency range (P1 - P2) 16 Hz ... 420 Hz

Displayed Test Current ($I_{\Delta set}$) is calculated as follows:

$$I_{\Delta set} = I_{gen} \times \text{ (number of turns)}$$

(Example:
$$I_{\Delta set} = 0.5 \text{ A} \times 10 = 5 \text{ A}$$
)

Notes:

- False Triggering can occur because of the high sensitivity of the internal voltmeter (P1-P2). Voltage dip can trigger an ELR, MRCD test.
- Improper connection will trigger a measurement abort (C1 C2 terminal open).



Measurement is aborted. Consider displayed warnings and messages.

- System voltage and frequency kept constant during measurement!
- Make sure that the number of turns is correctly entered in the test parameters window!

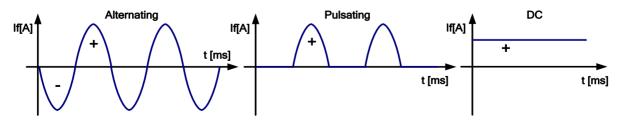


Figure 9.2: Current waveform shape

9.6 Current [I]

9.6.1 Iron (A 1281) and Flex (A 1227, A 1609) current clamp

Measurement principle: Current measurement (RMS)

Current	Туре	Range (A)	Measuring range (A)	Display range (A)	Resolution (A)	Overall Uncertainty (* See notes)
		0.5	10 m 749 m	0 m 749 m	1 m	
		5	0.10 7.49	0.00 7.49	0.01	1/2 F 0/ of reading
	A 1281	100 2	2 149	0.0 99.9 A	0.1	\pm (2.5 % of reading + 3 digits)
1.				100 149	1	
1	1000	20 999	0 999	1		
	A 1227 A 1609 300 3000	30	0.6 59.9	0.0 59.9	0.1	±/2 F 0/ of roading
		300	6 599	0 599	1 A	\pm (3.5 % of reading
		3000	0.06 k 5.99 k	0.00 k 5.99 k	0.01 k	+ 3 digits)

Input terminal galvanic separated (clamp connector)

Test mode continuous

Measuring frequency range...... 16 Hz ... 420 Hz

Instrument accuracy (clamp connector)...... 2 %

Measuring refresh rate 3 s typical

*Notes:

- Minor exceeding the clamp range will cause the instrument to display > and the appropriate range (e.g. >599 A).
- Large exceeding of the clamp range or wrong clamps selected will cause the horizontal dashes (- -) to be displayed.
- Frequency is only displayed if ($I_m \ge 1 \% I_{clamp_range}$), where I_m presents measured current and I_{clamp_range} set value of clamp range. Otherwise the horizontal dashes (- -) are displayed.
- Overall uncertainty (as percent of measured value), is provided as guideline. For exact measuring range and uncertainty, please check user manual of related current clamps. Overall uncertainty is calculated as:

$$OverallAccuracy = 1,15 \cdot \sqrt{InstrumentAccuracy^2 + ClampAccuracy^2}$$

9.7 Test Current

Measurement function Z line $m\Omega$, Z loop $m\Omega$, High Current, U touch

Test Current (I_{test}) is set as follows:

$$I_{test} = \frac{U_{ac}}{Test_load + R_leads + R_int} \pm 15\%$$

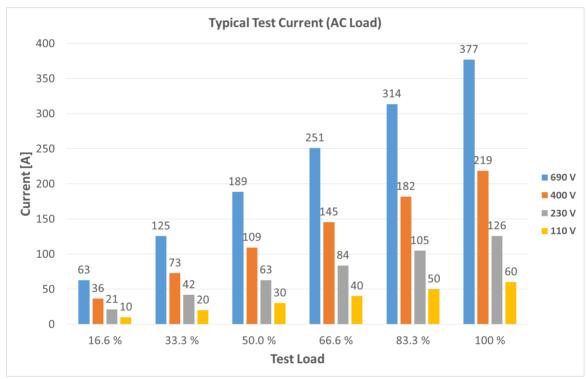


Figure 9.3: Typical test currents (AC Load) in relation to nominal voltage and test load

Internal variable load power resistor with 6-stage value setup.

Test load parameter	Equivalent load resistance
16.6 %	11.0 Ω
33.3 %	5.50 Ω
50.0 %	3.66Ω
66.6 %	2.75 Ω
83.3 %	2.20 Ω
100 %	1.83 Ω

Note:

• Test leads resistance for standard suppled leads C1 + C2 is typ. 60 m Ω (red leads 2.5 m, 1.5 mm²).

9.8 General data

Battery charging time typical 3.0 h (deep discharge)

Over-voltage category 300 V CAT II

Battery operation time:

Idle state > 24 h

Measurements......> 12 h continuous testing for line, loop, high current

Auto-off timer10 min (idle state)

Protection classification..... reinforced insulation

Measuring category 600 V CAT IV

Pollution degree......2

Degree of protection...... IP 65 (case closed), IP 54 (case open)

Visual warningsyes

Reference conditions:

Reference humidity range 40 %RH ... 60 %RH

Operation conditions:

Working temperature range -10 °C ... 50 °C

Working nominal altitude up to 3000 m

Storage conditions:

Temperature range -10 °C ... 70 °C

Maximum relative humidity...... 90 %RH (-10 °C ... 40 °C)

RS 232 communication:

RS 232 serial communication...... galvanic separated

Connector: standard RS232 9-pin D male

Bluetooth communication:

Bluetooth module class 2

Specifications are quoted at a coverage factor of k = 2, equivalent to a confidence level of approximately 95 %. Accuracies apply for 1 year in reference conditions. Temperature coefficient outside these limits is 0.2 % of measured value per $^{\circ}$ C, and 1 digit.

Appendix A – Supported Instruments Selection Table

Supported instruments and devices are:

- MI 3155 EurotestXD;
- MI 3152 EurotestXC;
- ➤ MI 3325 MultiServicerXD;
- > aMESM (Android App).

	Measurement functions available		MI 3155	MI 3152	MI 3325	aMESM
MI 3144 Euro Z 800 V			EurotestXD	EurotestXC	MultiServicerXD	
	lcon	Group				
Z line mΩ	$Zm\Omega_{L-N}$	Impedance	•	•	•	•
Z loop mΩ	$Zm\Omega$ L-Pe	Impedance	•	•	•	•
High Current	ΔR300A High Current	Impedance	•	•	•	•
R line mΩ	$Rm\Omega_{DC}$ R line $m\Omega$	Resistance	•	•	•	•
U touch	UTouch U touch	Potential	•	•	•	•
Current Injection Test	 ELR Current Inj	ELR	•	•	•	•
Combination Time Test	t ELR Combinatio	ELR	•	•	•	•
Current Clamp Meter	Current Clamp	Current	•	•	•	•

Appendix B - MRCD Test (acc.to IEC 60947-2 Annex M)

I. Current Injection Test

AC Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **steadily increased**, starting form a value not higher than 0.2 x $I\Delta n$, up to $I\Delta n$ (set value) in approximately 30 s. The current value causing change (OFF) in the status of the circuit breaker is displayed as $I\Delta n$.

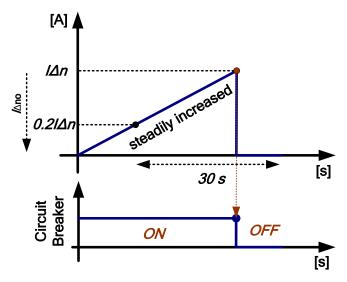


Figure B.1: Current Injection Test waveforms example (AC Type)

where:	
IΔn	Residual operating current
IΔno	Non-operating residual current

Note (acc.to IEC 60947-2 Annex M):

- \Box IAn Residual operating current (value of the residual current, which causes the ELR (MRCD) to operate under specified conditions)
- □ I∆no Non-operating residual current (value of the residual current at which the ELR (MRCD) does not operate under specified conditions)

A Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **steadily increased**, starting from zero, up to 1.4 x $I\Delta n$ or 2 x $I\Delta n$ (depending on the set value) in approximately 30 s. The current value causing change (OFF) in the status of the circuit breaker is displayed as $I\Delta n$.

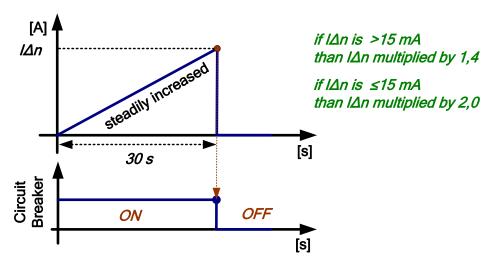


Figure B.2: Current Injection Test waveforms example (A Type)

B Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **steadily increased**, starting from zero, up to 2 x $I\Delta n$ (set value) in approximately 30 s. The current value causing change (OFF) in the status of the circuit breaker is displayed as $I\Delta n$.

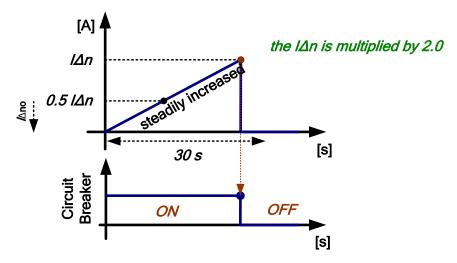


Figure B.3: Current Injection Test waveforms example (B Type)

II. Combination Time Test

AC Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **suddenly established** (set value $I\Delta n$).

The instrument is measuring the combination time (ELR + Circuit Breaker) from establishing the current ($I\Delta n$) to the change detected in the circuit breaker OFF state.

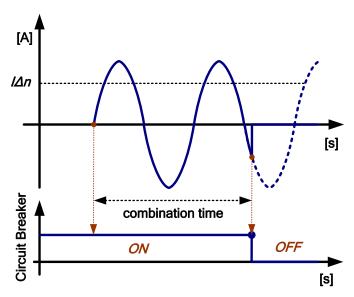


Figure B.4: Combination Time Test current waveforms example (AC Type)

where: tΔnTotal operating time or combination time lΔnResidual operating current

Note (acc.to IEC 60947-2 Annex M):

□ Total operating time of an MRCD and associated circuit breaker (**combination time**) - Time, which elapses between the instant when the residual operating current is suddenly applied and the instant of the arc extinction of the associated circuit breaker.

A Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **suddenly established** (1.4 x $I\Delta n$ or 2 x $I\Delta n$ -depending on the set value).

The instrument is measuring the combination time (ELR + Circuit Breaker) from establishing the current ($I\Delta n$) to the change detected in the circuit breaker OFF state.

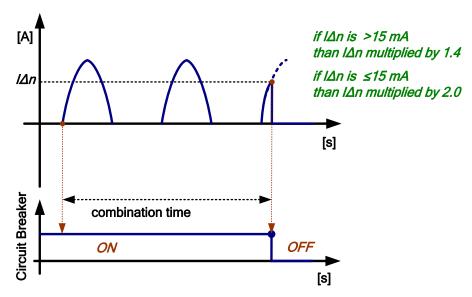


Figure B.5: Combination Time Test current waveforms example (A Type)

B Type ELR (MRCD) test procedure

During the measurement the circuit breaker is in the closed position (ON), and the ELR (MRCD) being ready to operate, the residual current is **suddenly established** (set value 2 x $I\Delta n$). The instrument is measuring the combination time (ELR + Circuit Breaker) from establishing the current ($I\Delta n$) to the change detected in the circuit breaker OFF state.

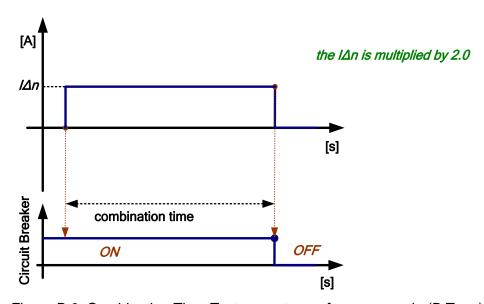


Figure B.6: Combination Time Test current waveforms example (B Type)

Appendix C – Short-circuit currents in 3p a.c. systems

Voltage factor c according to the EN 60909 - 0

Nominal system voltage U _n		Voltage factor c	
	voltage system with	Maximum	Minimum
	a tolerance	short-circuit currents	short-circuit currents
	(Tolerance)	C _{max}	C _{min}
100 V/ to 1000 V/	±6 %	1.05	0.95
100 V to 1000 V	±10 %	1.10	0.90

Z loop $m\Omega$ Measurement

The prospective fault currents I_{Min} and I_{Max} are calculated as follows:

$I_{Min} = \frac{C_{min}U_{N(L-PE)}}{Z_{(L-PE)hot}}$	where	$Z_{(L-PE)hot} = \sqrt{(1.5 \times R_{L-PE})^2 + X_{L-PE}^2}$ $C_{min} = \begin{cases} 0.95; \ U_{N(L-PE)} \pm 6\% \\ 0.90; \ U_{N(L-PE)} \pm 10\% \end{cases}$
$I_{Max} = \frac{C_{max}U_{N(L-PE)}}{Z_{L-PE}}$	where	$Z_{L-PE} = \sqrt{R_{L-PE}^2 + X_{L-PE}^2}$ $C_{max} = \begin{cases} 1.05; U_{N(L-PE)} \pm 6 \% \\ 1.10; U_{N(L-PE)} \pm 10 \% \end{cases}$

Z line mΩ Measurement

The prospective short-circuit currents I_{Min} , I_{Min2p} , I_{Min3p} and I_{Max} , I_{Max2p} , I_{Max3p} are calculated as follows:

follows:		
$I_{Min} = \frac{C_{min} \times U_{N(L-N)}}{Z_{(L-N)hot}}$	where	$Z_{(L-N)hot} = \sqrt{(1.5 \times R_{(L-N)})^2 + X_{(L-N)}^2}$ $C_{min} = \begin{cases} 0.95; \ U_{N(L-N)} \pm 6 \% \\ 0.90; \ U_{N(L-N)} \pm 10 \% \end{cases}$
$I_{Max} = \frac{C_{max} \times U_{N(L-N)}}{Z_{(L-N)}}$	where	$Z_{(L-N)} = \sqrt{R_{(L-N)}^2 + X_{(L-N)}^2}$ $C_{max} = \begin{cases} 1.05; U_{N(L-N)} \pm 6 \% \\ 1.10; U_{N(L-N)} \pm 10 \% \end{cases}$
$I_{Min2p} = \frac{C_{min} \times U_{N(L-L)}}{Z_{(L-L)hot}}$	where	$Z_{(L-L)hot} = \sqrt{(1.5 \times R_{(L-L)})^2 + X_{(L-L)}^2}$ $C_{min} = \begin{cases} 0.95; \ U_{N(L-L)} \pm 6 \% \\ 0.90; \ U_{N(L-L)} \pm 10 \% \end{cases}$
$I_{Max2p} = \frac{C_{max} \times U_{N(L-L)}}{Z_{(L-L)}}$	where	$Z_{(L-L)} = \sqrt{R_{(L-L)}^2 + X_{(L-L)}^2}$ $C_{max} = \begin{cases} 1.05; U_{N(L-L)} \pm 6 \% \\ 1.10; U_{N(L-L)} \pm 10 \% \end{cases}$
$I_{Min3p} = \frac{C_{min} \times U_{N(L-L)}}{\sqrt{3}} \frac{2}{Z_{(L-L)hot}}$	where	$Z_{(L-L)hot} = \sqrt{(1.5 \times R_{(L-L)})^2 + X_{(L-L)}^2}$ $C_{min} = \begin{cases} 0.95; \ U_{N(L-L)} \pm 6 \% \\ 0.90; \ U_{N(L-L)} \pm 10 \% \end{cases}$
$I_{Max3p} = \frac{C_{max} \times U_{N(L-L)}}{\sqrt{3}} \frac{2}{Z_{(L-L)}}$	where	$Z_{(L-L)} = \sqrt{R_{(L-L)}^2 + X_{(L-L)}^2}$ $C_{max} = \begin{cases} 1.05; U_{N(L-L)} \pm 6 \% \\ 1.10; U_{N(L-L)} \pm 10 \% \end{cases}$